

SERVICE BULLETIN

AUTOMATIC MUSIC, INC.

1500 UNION AVENUE, S. E., GRAND RAPIDS 2, MICHIGAN • TELEPHONE CHERRY 3-3633



BULLETIN No. 188

NEW CIRCUIT BOARD AND FUSE FOR THE R-1473 CREDIT UNIT

Hi! In case we have not met before, my name is SWAMI — in recognition of my years of "Service With AMI." I am devoted to helping operators and service men enjoy trouble-free and profitable performance of their AMI equipment.

In offering the new circuit board and fuse feature, as announced in this bulletin, we are following the AMI tradition of offering you another opportunity to keep your present equipment up-to-date and trouble free.




A recent change in the R-1473 credit unit incorporates an 8/10 amp. slow blow fuse on the switch circuit assembly. This fuse protects the main credit solenoid in case a light weight or bent coin lodges on the coin switches.



This change requires a new switch circuit board assembly (part No. F-10344) which replaces and supersedes earlier versions of this part.

The new switch circuit board can be used in all versions of the R-1473 credit unit. The following sketches show the proper connections.

See illustrations on second page of this bulletin

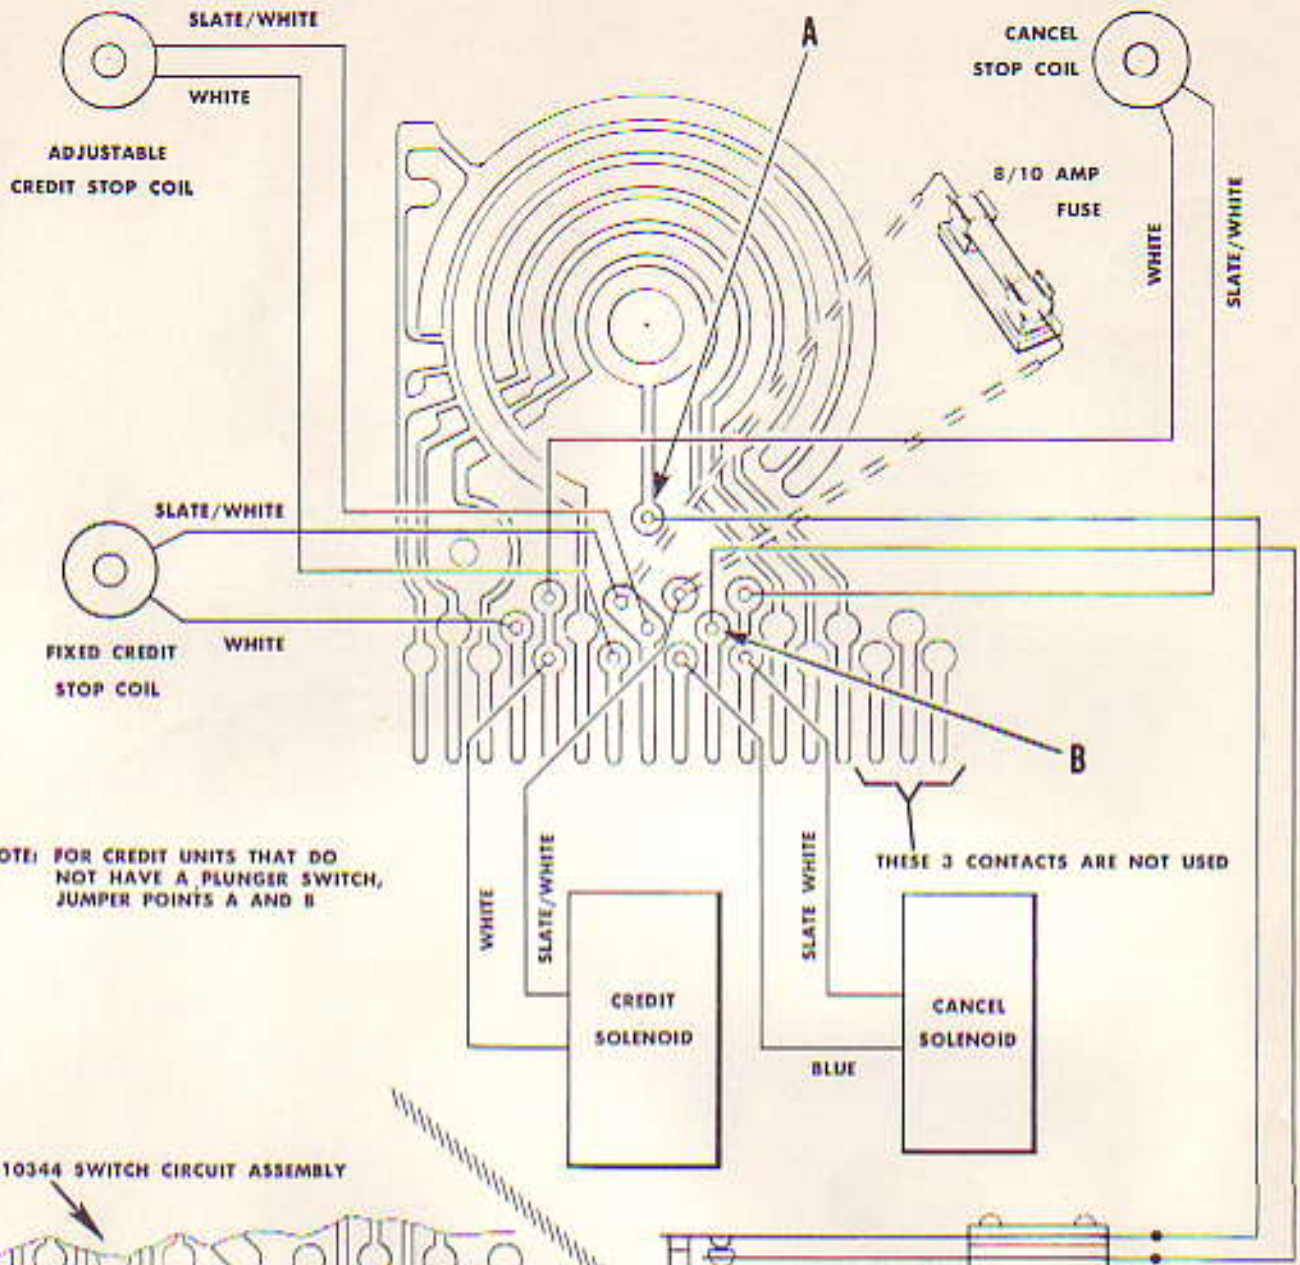

F-10344 SWITCH CIRCUIT ASSEMBLY

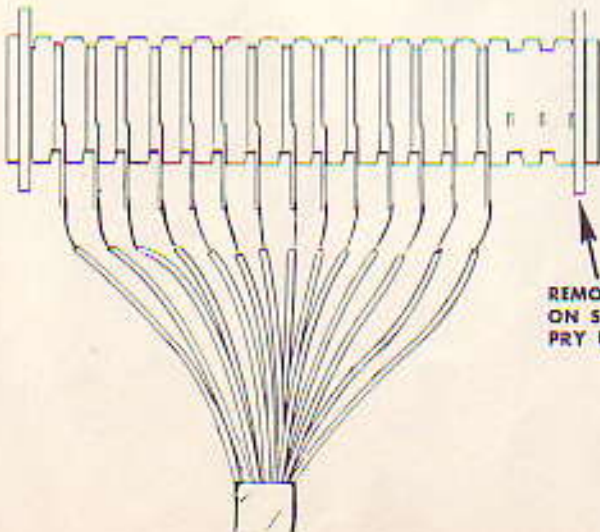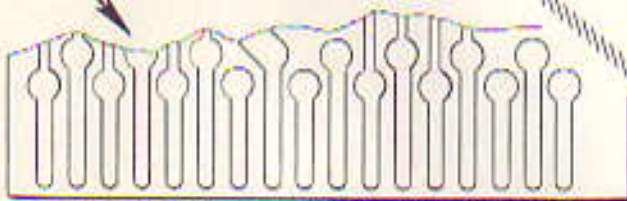

REMOVE THIS GUIDE
ON SHORT EDGE CONNECTORS
PRY UP CLIPS TO REMOVE

